

Tested by

Name

Mr S Dwight

Position

Technician

Date

20 August 2007

Signature

Prepared by

Name

Mr A Heath

Position

Consultant

Date

20 August 2007

Signature

Checked by

Name

MMr G McCann

Position

Senior Consultant

Date

20 August 2007

Signature

Approved on behalf of BRE

Name

Dr R Hall

Position

Principal Consultant

Date

20 August 2007

Signature

BRE Garston WD25 9XX T + 44 (0) 1923 664000 F + 44 (0) 1923 664010

E enquiries@bre.co.uk

Www.bre.co.uk

BRE is not UKAS accredited to make opinions and interpretation. Any opinions and interpretations included as part of this report are clearly marked as such.



0578

This report may only be distributed in its entirety and in accordance with the terms and conditions of the contract. Test results relate only to the items tested. BRE has no responsibility for the design, materials, workmanship or performance of the product or items tested. This report does not constitute an approval, certification or endorsement of the product tested.

This report is made on behalf of BRE. By receiving the report and action on it, the client – or any third party relying on it – accepts that no individual is personally liable in contract, tort or breach of statutory duty (including negligence).

1 Introduction

BRE Acoustics was commissioned by Rytons Building Products Ltd to carry out airborne sound insulation measurements in the BRE horizontal transmission suite (Building 9), BRE, Garston, Watford, Hertfordshire, WD25 9XX.

This report details the testing outlined in BRE proposal 7020 - 120272.

2 Testing details

2.1 Test dates and personnel

The measurements detailed in this report were made between 18 July 2007 and 26 July 2007 by Mr A Heath, Mr S Dwight and Mr K Jaitly of BRE Acoustics.

2.2 Test method and applicable standards


Measurement of airborne sound insulation was made in accordance with BS EN 20140-10:1992 and BS EN ISO 140-3:1995. First the airborne sound insulation of the filler wall was measured. After this, the airborne sound insulation of the filler wall with the different ventilator systems was measured.

Single number quantities were calculated in accordance with BS EN ISO 717-1:1997.

BRE Acoustics holds UKAS accreditation for the measurement of sound insulation in the field and the laboratory. The measurements were conducted using the procedures accredited by UKAS.

2.3 Test element installation

The filler wall was installed by BRE. The ventilator systems tested were supplied by Rytons Building Products Ltd and installed in the filler wall by BRE. Ventilators were installed with a simulated edge in the receive room in accordance with 6.2 and 6.3.1.2 of BS EN 20140-10:1992.

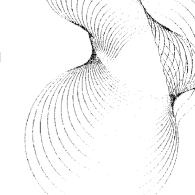

2.4 Instrumentation

The equipment used to conduct the tests is identified in Table 1.

Table 1 Equipment list

| Equipment description | Manufacturer | Туре | UKAS identification number |
|--------------------------|--------------|---------|----------------------------|
| Microphone Calibrator | NOR | 1253 | 01/006 |
| Microphone | GRAS | 40AE | 02/302, 02/305 |
| Microphone Preamplifier | GRAS | 26CA | 04/302, 04/305 |
| Microphone Adapter | NOR | 1449 | 06/105, 06/106 |
| Graphic Equaliser | Phonic | PEQ3300 | 10/001 |
| Real Time Analyser | NOR | 840 | 13/003, 13/005 |
| Microphone Rotating Boom | B&K | 3923 | 14/001, 14/002 |
| Loudspeaker | B&K | 4224 | 11/006 |
| Loudspeaker | NOR | 270H | 11/014, 11/016 |
| Amplifier | NOR | 260 H | 11/013 |

The gain of the real time analyser was adjusted to give a reading of 124.0 dB at 250 Hz using the B&K type 4231 calibrator.

All equipment is calibrated in accordance with BRE procedures, using reference equipment calibrated by a UKAS accredited laboratory.

2.8 Plans

The position of the filler wall in the transmission suite aperture is indicated in Figure 1.

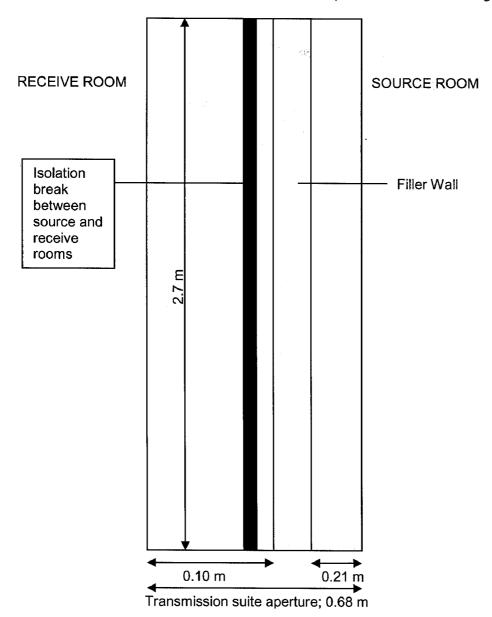


Figure 1 Section through elevation showing the position of the filler wall in the transmission suite aperture



Laboratory measurement of airborne sound insulation of building elements Sound reduction index according to BS EN ISO 140-3:1995

BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 18/07/2007

Test number: L107-131

Test element: Filler wall

0578

Test element area:

9.8 m²

Mass per unit area:

52 kg/m²

Description:

2x15 mm Standard Wallboard (10.0 kg/m²) screwed to, 50 mm x 100 mm timber studs at 600 mm centres 300 mm cavity between studs fully filled with isowool (mineral fibre),

50 mm x 100 mm timber studs at 600 mm centres

2x15 mm Standard Wallboard (10.0 kg/m²) screwed to studs.

Source room volume:

130 m³

Air temperature:

19 °C

Receive room volume:

115 m³

Air relative humidity:

75 %

| - | | | · · · · · · · · · · · · · · · · · · · | | |
|-----------|---------------|------------|---------------------------------------|---------|------|
| Frequency | Reverberation | Background | Source | Receive | R |
| | time | level | level | level | |
| (Hz) | (s) | (dB) | (dB) | (dB) | (dB) |
| 50 | 2.90 | 26.0 | 88.1 | 57.0 | 33.0 |
| 63 | 2.88 | 19.2 | 97.3 | 68.7 | 30.4 |
| 80 | 1.69 | 17.3 | 98.0 | 61.2 | 36.3 |
| 100 | 1.45 | 12.3 | 98.7 | 58.4 | 39.2 |
| 125 | 1.94 | 9.1 | 101.0 | 55.9 | 45.2 |
| 160 | 1.79 | 7.9 | 101.6 | 49.5 | 51.8 |
| 200 | 1.79 | 20.0 | 102.8 | 46.8 | 55.8 |
| 250 | 1.77 | 8.2 | 98.5 | 38.3 | 60.0 |
| 315 | 1.71 | 11.8 | 101.9 | 38.8 | 62.7 |
| 400 | 1.71 | 18.3 | 102.4 | 35.5 | 66.5 |
| 500 | 1.64 | 10.5 | 101.5 | 32.7 | 68.2 |
| 630 | 1.59 | 10.0 | 99.1 | 31.1 | 67.3 |
| 800 | 1.62 | 9.0 | 97.4 | 31.1 | 65.7 |
| 1,000 | 1.53 | 14.6 | 104.4 | 35.9 | 67.6 |
| 1,250 | 1.53 | 13.5 | 107.2 | 33.1 | 73.2 |
| 1,600 | 1.58 | 5.4 | 109.3 | 33.4 | 75.1 |
| 2,000 | 1.60 | 6.1 | 107.7 | 33.0 | 74.0 |
| 2,500 | 1.59 | 6.4 | 106.5 | 29.1 | 76.6 |
| 3,150 | 1.53 | 6.9 | 105.3 | 25.3 | 79.1 |
| 4,000 | 1.49 | 7.5 | 104.3 | 19.3 | 84.0 |
| 5,000 | 1.35 | 8.8 | 101.1 | 12.9 | 86.8 |

⁺ Receiving room level adjusted for background

Rating according to BS EN ISO 717-1:1997 $R_{\rm w}(C;C_{\rm tr}) = 67 (-3;-10) \, {\rm dB} \, C_{50-3150} = -6 \, {\rm dB} \, C_{50-5000} = -5 \, {\rm dB}$

 $C_{\text{tr,50-3150}}$ = -17 dB $C_{\text{tr,50-5000}}$ = -17 dB

 $C_{100-5000}$ = -2 dB $C_{tr,100-5000}$ = -10 dB

Evaluation based on laboratory measurement results obtained by an engineering method

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ± 1 dB for the single-number quantity (R_w) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves (R)

^{*} Receiving room level within 6 dB of background



Laboratory measurement of airborne sound insulation of building elements Sound reduction index according to BS EN ISO 140-3:1995

BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 18/07/2007

Test number: L107-131

Test element: Filler wall

Test element area:

9.8 m²

Mass per unit area:

52 kg/m²

Description:

2x15 mm Standard Wallboard (10.0 kg/m²) screwed to, 50 mm x 100 mm timber studs at 600 mm centres 300 mm cavity between studs fully filled with isowool (mineral fibre),

50 mm x 100 mm timber studs at 600 mm centres

2x15 mm Standard Wallboard (10.0 kg/m²) screwed to studs.

Source room volume:

130 m³

Air temperature:

19 °C


Receive room volume:

115 m³

Air relative humidity:


75 %

| | R |
|---------------|-----------|
| Frequency | One-third |
| (Hz) | octave |
| \· ' / | (dB) |
| 50 | 33.0 |
| 63 | 30.4 |
| 80 | 36.3 |
| 100 | 39.2 |
| 125 | 45.2 |
| 160 | 51.8 |
| 200 | 55.8 |
| 250 | 60.0 |
| 315 | 62.7 |
| 400 | 66.5 |
| 500 | 68.2 |
| 630 | 67.3 |
| 800 | 65.7 |
| 1,000 | 67.6 |
| 1,250 | 73.2 |
| 1,600 | 75.1 |
| 2,000 | 74.0 |
| 2,500 | 76.6 |
| 3,150 | 79.1 |
| 4,000 | 84.0 |
| 5,000 | 86.8 |

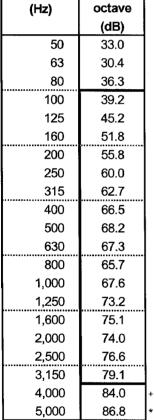

⁺ Receiving room level adjusted for background

^{*} Receiving room level within 6 dB of background

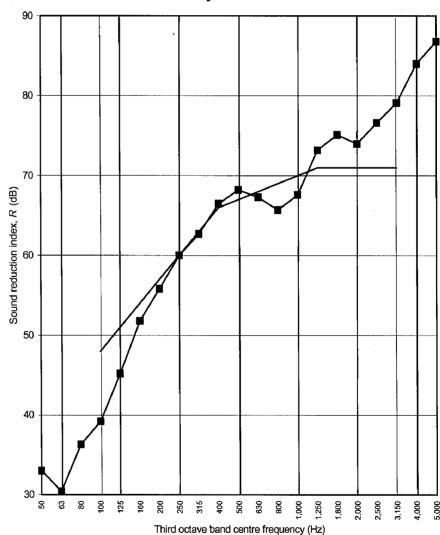

Rating according to BS EN ISO 717-1:1997

= 67 (-3;-10) dB $C_{50-3150}$

C_{tr,50-3150}

= -6 dB= -17 dB $C_{50-5000}$ C_{tr.50-5000} = -5 dB= -17 dB

C₁₀₀₋₅₀₀₀ C_{tr,100-5000} = -2 dB $= -10 \, dB$

Evaluation based on laboratory measurement results obtained by an engineering method

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity (R_{w}) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves (R)



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-161

Test element: Ventilator

0578

Filler wall area:

9.8 m²

Description:

TAL9H&M ventilator assembly:

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (OPEN)

Source room volume:

130 m³

Air temperature:

20 °C

Receive room volume:

115 m³

Air relative humidity:

65 %

| ıτy: | 65 | % |
|------|----|---|
| | | |

| Frequency | Reverberation | Background | Source | Receive | D _{n,e} | ٦ |
|-----------|---------------|------------|--------|---------|------------------|---|
| | time | level | level | level | · | |
| (Hz) | (s) | (dB) | (dB) | (dB) | (dB) | |
| 50 | 2.45 | 25.9 | 90.3 | 57.7 | 35.2 | 0 |
| 63 | 2.10 | 17.7 | 99.0 | 69.2 | 31.7 | 0 |
| 80 | 2.01 | 16.6 | 98.1 | 63.9 | 35.9 | o |
| 100 | 1.62 | 17.2 | 98.1 | 60.4 | 38.4 | 0 |
| 125 | 2.17 | 10.7 | 101.3 | 64.3 | 38.5 | x |
| 160 | 1.87 | 19.0 | 100.6 | 67.1 | 33.5 | |
| 200 | 1.91 | 34.5 | 101.2 | 67.3 | 34.1 | |
| 250 | 1.77 | 13.4 | 99.2 | 68.6 | 30.4 | |
| 315 | 1.66 | 13.5 | 99.1 | 72.4 | 26.2 | ı |
| 400 | 1.61 | 22.7 | 98.8 | 69.4 | 28.9 | |
| 500 | 1.58 | 10.0 | 98.1 | 65.9 | 31.5 | |
| 630 | 1.56 | 10.5 | 97.7 | 59.9 | 37.1 | |
| 800 | 1.54 | 9.7 | 96.7 | 57.9 | 37.9 | ı |
| 1,000 | 1.43 | 16.4 | 95.4 | 56.1 | 38.2 | ı |
| 1,250 | 1.47 | 14.8 | 97.2 | 54.4 | 41.9 | |
| 1,600 | 1.49 | 6.2 | 97.9 | 56.0 | 41.0 | ı |
| 2,000 | 1.50 | 6.6 | 96.4 | 50.3 | 45.2 | |
| 2,500 | 1.51 | 7.0 | 96.8 | 46.4 | 49.5 | |
| 3,150 | 1.45 | 8.5 | 96.8 | 42.0 | 53.7 | |
| 4,000 | 1.36 | 9.7 | 97.7 | 44.8 | 51.6 | |
| 5,000 | 1.23 | 8.4 | 94.7 | 40.9 | 52.0 | |

x Adjusted for flanking transmission

o Correction = 1.3 dB

Rating according to BS EN ISO 717-1:1997 $D_{n,e,w}(C;C_{tr}) = 38 \text{ (-1;-3) dB} \qquad C_{50\text{-}3150} \qquad = -1 \text{ dB} \qquad C_{50\text{-}5000} \qquad = 0 \text{ dB} \qquad C_{100\text{-}5000} \qquad = 0 \text{ dB}$ $C_{tr,50\text{-}3150} \qquad = -3 \text{ dB} \qquad C_{tr,50\text{-}5000} \qquad = -3 \text{ dB} \qquad C_{tr,100\text{-}5000} \qquad = -3 \text{ dB}$ Evaluation based on laboratory measurement results obtained by an engineering method

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ± 1 dB for the single-number quantity ($D_{n,e,w}$) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves ($D_{n,e,w}$)



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992

BRE horizontal transmission suite (B9 051-053)

Rytons Building Products Ltd Client: Test date: 25/07/2007

Test number: L107-161

Test element: Ventilator

0578

Filler wall area:

9.8 m²

Description:

TAL9H&M ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (OPEN)

Source room volume:

130 m³

Air temperature:

20 °C


Receive room volume:


115 m³

Air relative humidity:

65 %

| | $oldsymbol{D}_{n,\mathbf{e}}$ | |
|-----------|-------------------------------|---|
| Frequency | One-third | |
| (Hz) | octave | |
| | (dB) | |
| 50 | 35.2 | þ |
| 63 | 31.7 | þ |
| 80 | 35.9 | 4 |
| 100 | 38.4 | ١ |
| 125 | 38.5 | 2 |
| 160 | 33.5 | |
| 200 | 34.1 | Ì |

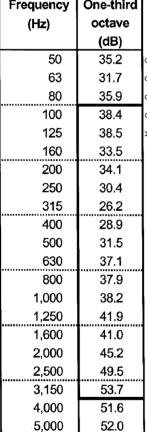

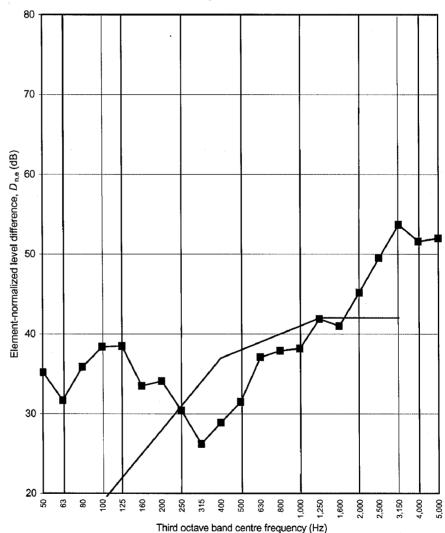

x Adjusted for flanking transmission

o Correction = 1.3 dB

Rating according to BS EN ISO 717-1:1997

 $D_{n,e,w}(C;C_{tr}) = 38 (-1;-3) dB$ $C_{50-3150}$ = -1 dB= -3 dB C₅₀₋₅₀₀₀ $C_{\rm tr,50-5000}$ = 0 dB= -3 dB C₁₀₀₋₅₀₀₀ C_{tr,100-5000} = 0 dB= -3 dB

Evaluation based on laboratory measurement results obtained by an engineering method

C_{tr.50-3150}

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity (D_{n.e.w}) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves (D_{n.e.w})



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Rytons Building Products Ltd

Test date: 25/07/2007 Test number: L107-162

0578

Filler wall area:

Test element: Ventilator

9.8 m²

Description:

TAL9H&M ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (CLOSED)

Source room volume:

130 m³

Air temperature:

20 °C

Receive room volume:

115 m³

Air relative humidity:

65 %

| Frequency | Reverberation | Background | Source | Receive | D _{n,e} | ٦ |
|-----------|---------------|------------|--------|---------|------------------|--------|
| | time | level | level | level | , | 1 |
| (Hz) | (s) | (dB) | (dB) | (dB) | (dB) | , |
| 50 | 2.45 | 28.7 | 91.0 | 57.9 | 35.7 | \neg |
| 63 | 2.10 | 20.5 | 99.4 | 67.8 | 33.5 | 0 |
| 80 | 2.01 | 19.0 | 97.9 | 63.4 | 36.2 | 0 |
| 100 | 1.62 | 17.6 | 98.5 | 60.6 | 38.7 | 0 |
| 125 | 2.17 | 13.2 | 101.0 | 63.7 | 38.9 | x |
| 160 | 1.87 | 18.4 | 100.7 | 66.5 | 34.2 | |
| 200 | 1.91 | 33.9 | 101.3 | 67.2 | 34.3 | |
| 250 | 1.77 | 13.4 | 99.2 | 68.3 | 30.7 | |
| 315 | 1.66 | 13.9 | 99.2 | 72.0 | 26.7 | |
| 400 | 1.61 | 24.9 | 98.9 | 69.0 | 29.3 | |
| 500 | 1.58 | 10.0 | 98.1 | 65.0 | 32.4 | |
| 630 | 1.56 | 11.5 | 97.6 | 58.9 | 37.9 | |
| 800 | 1.54 | 10.5 | 96.7 | 57.4 | 38.4 | |
| 1,000 | 1.43 | 15.7 | 95.5 | 55.4 | 38.9 | |
| 1,250 | 1.47 | 13.0 | 97.2 | 54.1 | 42.1 | |
| 1,600 | 1.49 | 6.9 | 97.9 | 55.0 | 42.0 | |
| 2,000 | 1.50 | 6.9 | 96.5 | 48.5 | 47.1 | |
| 2,500 | 1.51 | 7.4 | 96.9 | 44.3 | 51.7 | |
| 3,150 | 1.45 | 8.0 | 96.8 | 40.0 | 55.8 | |
| 4,000 | 1.36 | 8.3 | 97.7 | 42.4 | 53.9 | |
| 5,000 | 1.23 | 9.8 | 94.7 | 38.2 | 54.7 | |

x Adjusted for flanking transmission

o Correction = 1.3 dB

| Rating according to BS EN ISO 717-1:1997 | | | | | | |
|---|---|--------------------|---|-------------------|---|-------------------|
| $D_{\text{n,e,w}}(C;C_{\text{tr}}) = 38 \text{ (-1;-3) dB}$ | C ₅₀₋₃₁₅₀ C _{tr,50-3150} | = -1 dB = -3 dB | C ₅₀₋₅₀₀₀ C _{tr.50-5000} | = 0 dB = -3 dB | C ₁₀₀₋₅₀₀₀ C _{tr.100-5000} | = 0 dB = -3 dB |
| Evaluation based on laboratory measurement result | | earing mathad | u,00-0000 | | - 4,100-3000 | |

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity ($D_{n,e,w}$) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves ($D_{n,e,w}$)



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-162

Test element: Ventilator

0578

Filler wall area:

9.8 m²

Description:

TAL9H&M ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (CLOSED)

Source room volume:

130 m³

Air temperature:


20 °C

115 m³

Air relative humidity:

65 %

| Receive room volume: | | | | |
|----------------------|-------------------------------|---|--|--|
| Frequency | D _{n,e} One-third | | | |
| (Hz) | octave | | | |
| | (dB) | | | |
| 50 | 35.7 | c | | |
| 63 | 33.5 | þ | | |
| 80 | 36.2 | < | | |
| 100 | 38.7 | c | | |
| 125 | 38.9 | 2 | | |
| 160 | 34.2 | | | |
| 200 | 34.3 | ١ | | |
| 250 | 30.7 | l | | |
| 315 | 26.7 | l | | |
| 400 | 29.3 | l | | |
| 500 | 32.4 | l | | |
| 630 | 37.9 | | | |
| 800 | 38.4 | | | |
| 1,000 | 38.9 | l | | |
| 1,250 | 42.1 | | | |
| 1,600 | 42.0 | 1 | | |
| 2,000 | 47.1 | ١ | | |

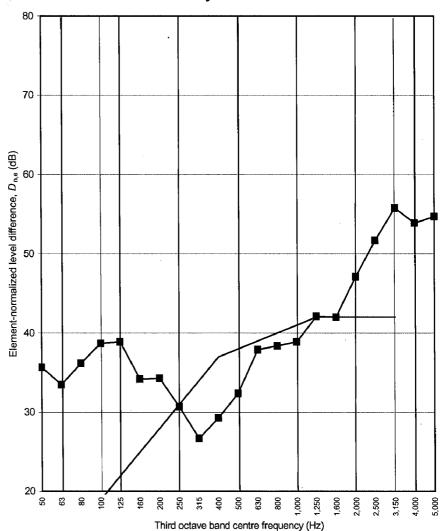

x Adjusted for flanking transmission

2,500

3,150

4,000

5,000

o Correction = 1.3 dB

Rating according to BS EN ISO 717-1:1997

51.7

55.8

53.9

 $D_{n,e,w}(C;C_{tr}) = 38 (-1;-3) dB$

= -1 dB= -3 dB

 $C_{50-5000}$ C_{tr,50-5000} = 0 dB= -3 dB C₁₀₀₋₅₀₀₀ C_{tr,100-5000} = 0 dB= -3 dB

Evaluation based on laboratory measurement results obtained by an engineering method

 $C_{50-3150}$

 $C_{\text{tr,50-3150}}$

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity (D_{n.e.w}) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves (D_{n.e.w})



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-163

Test element: Ventilator

0578

Filler wall area:

9.8 m²

Description:

TAL9HMCWL ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (OPEN), ABC9 Cowl

Source room volume:

130 m³

Air temperature:

20 °C

Receive room volume:

115 m³

Air relative humidity:

65 %

| Frequency | Reverberation | Background | Source | Receive | D _{n,e} | 7 |
|-----------|---------------|------------|--------|---------|--------------------|---|
| | time | level | level | level | - n _i e | |
| (Hz) | (s) | (dB) | (dB) | (dB) | (dB) | |
| 50 | 2.45 | 26.7 | 91.1 | 58.5 | 35.1 | 0 |
| , 63 | 2.10 | 21.4 | 99.3 | 69.1 | 32.1 | 0 |
| 80 | 2.01 | 17.5 | 98.1 | 64.2 | 35.6 | 0 |
| 100 | 1.62 | 18.2 | 98.2 | 60.8 | 38.2 | |
| 125 | 2.17 | 11.9 | 101.1 | 63.2 | 39.6 | x |
| 160 | 1.87 | 19.3 | 100.6 | 66.5 | 34.1 | |
| 200 | 1.91 | 34.8 | 101.1 | 67.9 | 33.4 | |
| 250 | 1.77 | 14.2 | 99.2 | 68.2 | 30.9 | |
| 315 | 1.66 | 13.1 | 99.2 | 68.2 | 30.5 | |
| 400 | 1.61 | 21.6 | 98.9 | 66.1 | 32.3 | |
| 500 | 1.58 | 9.9 | 98.2 | 63.5 | 34.0 | |
| 630 | 1.56 | 10.5 | 97.6 | 62.0 | 34.9 | |
| 800 | 1.54 | 9.7 | 96.7 | 53.8 | 42.0 | İ |
| 1,000 | 1.43 | 17.2 | 95.4 | 52.1 | 42.2 | ŀ |
| 1,250 | 1.47 | 12.4 | 97.3 | 51.0 | 45.3 | |
| 1,600 | 1.49 | 5.9 | 98.0 | 50.0 | 47.0 | |
| 2,000 | 1.50 | 6.2 | 96.4 | 44.3 | 51.2 | |
| 2,500 | 1.51 | 6.9 | 96.9 | 41.2 | 54.8 | |
| 3,150 | 1.45 | 9.0 | 96.9 | 37.2 | 58.7 | |
| 4,000 | 1.36 | 10.6 | 97.8 | 40.7 | 55.8 | |
| 5,000 | 1.23 | 8.2 | 94.7 | 37.5 | 55.4 | |

x Adjusted for flanking transmission

o Correction = 1.3 dB

| Rating according to BS EN ISO 717-1 | :1997 | | | | | | |
|--|---|-------------------|---|-------------------|---|-------------------|--|
| $D_{\text{n,e,w}}(C;C_{\text{tr}}) = 40 (0;-3) \text{ dB}$ | C ₅₀₋₃₁₅₀ C _{tr,50-3150} | = 0 dB = -3 dB | C ₅₀₋₅₀₀₀ C _{tr,50-5000} | = 0 dB = -3 dB | C ₁₀₀₋₅₀₀₀ C _{tr,100-5000} | = 0 dB = -3 dB | |
| Evaluation based on laboratory measurement results obtained by an engineering method | | | | | | | |

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity ($D_{n,e,w}$) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves ($D_{n,e,w}$)



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-163

Test element: Ventilator

Filler wall area:

9.8 m²

Description:

TAL9HMCWL ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (OPEN), ABC9 Cowl

Source room volume:

130 m³

Air temperature:

20 °C


Receive room volume:

115 m³

Air relative humidity:

65 %

| receive room volume. | | | | |
|----------------------|-------------------------------|---|--|--|
| Frequency | D _{n,e} One-third | | | |
| (Hz) | octave | ı | | |
| | (dB) | | | |
| 50 | 35.1 | С | | |
| 63 | 32.1 | С | | |
| 80 | 35.6 | С | | |
| 100 | 38.2 | c | | |
| 125 | 39.6 | x | | |
| 160 | 34.1 | | | |
| 200 | 33.4 | l | | |
| 250 | 30.9 | | | |
| 315 | 30.5 | | | |
| 400 | 32.3 | l | | |
| 500 | 34.0 | l | | |
| 630 | 34.9 | | | |
| 800 | 42.0 | 1 | | |
| 1,000 | 42.2 | | | |
| 1,250 | 45.3 | | | |
| 1,600 | 47.0 | | | |
| 2,000 | 51.2 | ١ | | |
| 2,500 | 54.8 | ١ | | |

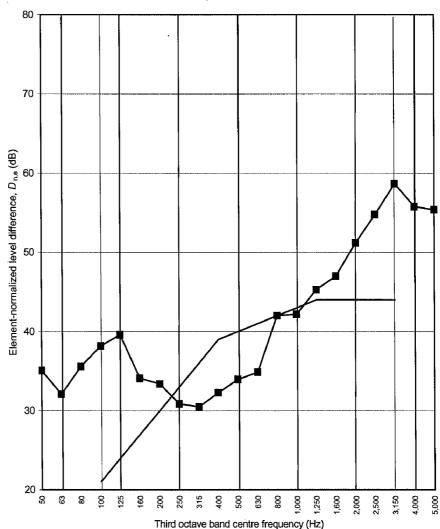

x Adjusted for flanking transmission

o Correction = 1.3 dB

3,150

4,000

5,000

Rating according to BS EN ISO 717-1:1997

58.7

55.8

55.4

 $D_{n,e,w}(C;C_{tr}) = 40 (0;-3) dB$

= 0 dB= -3 dB

C₅₀₋₅₀₀₀ $C_{\text{tr,50-5000}}$ = 0 dB= -3 dB C₁₀₀₋₅₀₀₀ C_{tr,100-5000} = 0 dB= -3 dB

Evaluation based on laboratory measurement results obtained by an engineering method

 $C_{50-3150}$

 $C_{\rm tr,50-3150}$

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity (D_{n.e.w}) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves (D_{n.e.w})



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client: Rytons

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-164

Test element: Ventilator

0578

Filler wall area:

9.8 m²

Description:

TAL9HMCWL ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (CLOSED), ABC9 Cowl

Source room volume:

130 m³

Air temperature:

20 °C

Receive room volume:

115 m³

Air relative humidity:

65 %

| Frequency | Reverberation | Background | Source | Receive | D _{n,e} | ٦ |
|-----------|---------------|------------|--------|---------|------------------|--------|
| | time | level | level | level | | |
| (Hz) | (s) | (dB) | (dB) | (dB) | (dB) | |
| 50 | 2.45 | 27.9 | 90.7 | 59.1 | 34.1 | \neg |
| 63 | 2.10 | 21.6 | 99.1 | 69.2 | 31.7 | . 0 |
| 80 | 2.01 | 17.8 | 98.1 | 64.3 | 35.5 | ० |
| 100 | 1.62 | 18.3 | 98.1 | 60.6 | 38.3 | ြ |
| 125 | 2.17 | 12.2 | 101.2 | 63.1 | 39.9 | x |
| 160 | 1.87 | 20.2 | 100.8 | 66.0 | 34.8 | |
| 200 | 1.91 | 35.8 | 101.2 | 67.0 | 34.4 | |
| 250 | 1.77 | 14.1 | 99.2 | 67.3 | 31.8 | |
| 315 | 1.66 | 13.0 | 99.2 | 67.6 | 31.1 | |
| 400 | 1.61 | 20.9 | 98.9 | 65.4 | 32.9 | |
| 500 | 1.58 | 9.4 | 98.2 | 62.1 | 35.4 | |
| 630 | 1.56 | 10.5 | 97.6 | 60.6 | 36.2 | |
| 800 | 1.54 | 9.6 | 96.6 | 52.6 | 43.2 | |
| 1,000 | 1.43 | 17.9 | 95.5 | 51.2 | 43.2 | |
| 1,250 | 1.47 | 12.2 | 97.2 | 50.3 | 46.0 | |
| 1,600 | 1.49 | 5.8 | 98.0 | 49.0 | 48.0 | |
| 2,000 | 1.50 | 6.2 | 96.4 | 42.7 | 52.8 | |
| 2,500 | 1.51 | 6.9 | 96.8 | 38.9 | 57.0 | - |
| 3,150 | 1.45 | 9.3 | 96.9 | 34.9 | 61.0 | 1 |
| 4,000 | 1.36 | 10.7 | 97.8 | 38.7 | 57.8 | |
| 5,000 | 1.23 | 8.1 | 94.7 | 35.2 | 57.8 | |

x Adjusted for flanking transmission

o Correction = 1.3 dB

| Rating according to BS EN ISO 717-1: | 1997 | | | | | |
|---|---------------------------------------|--------------------|--------------------------------|-------------------|---|-------------------|
| $D_{n,e,w}(C;C_{tr}) = 41 (-1;-3) dB$ | $C_{50-3150}$ $C_{\text{tr},50-3150}$ | = -1 dB = -3 dB | $C_{50-5000} \ C_{tr,50-5000}$ | = 0 dB = -3 dB | C ₁₀₀₋₅₀₀₀ C _{tr,100-5000} | = 0 dB = -3 dB |
| Evaluation based on laboratory measurement result | s obtained by an engin | eering method | | | | |

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ± 1 dB for the single-number quantity ($D_{n,e,w}$) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves ($D_{n,e,w}$)



Laboratory measurement of airborne sound insulation of small building elements Element-normalized level difference according to BS EN 20140-10:1992 BRE horizontal transmission suite (B9 051-053)

Client:

Rytons Building Products Ltd

Test date: 25/07/2007

Test number: L107-164

Test element: Ventilator

Filler wall area:

9.8 m²

Description:

TAL9HMCWL ventilator assembly;

x3 MFAB, TAL9x9 AirLiner1, HM123F Internal (CLOSED), ABC9 Cowl

Source room volume:

130 m³

Air temperature:


20 °C

115 m³

Air relative humidity:

65 %

| Receive room volume: | | | | | | | |
|----------------------|-------------------------------|---|--|--|--|--|--|
| Frequency | D _{n,e} One-third | | | | | | |
| (Hz) | octave | l | | | | | |
| | (dB) | | | | | | |
| 50 | 34.1 | c | | | | | |
| 63 | 31.7 | c | | | | | |
| 80 | 35.5 | d | | | | | |
| 100 | 38.3 | c | | | | | |
| 125 | 39.9 | þ | | | | | |
| 160 | 34.8 | | | | | | |
| 200 | 34.4 | | | | | | |
| 250 | 31.8 | | | | | | |
| 315 | 31.1 | | | | | | |
| 400 | 32.9 | 1 | | | | | |
| 500 | 35.4 | l | | | | | |
| 630 | 36.2 | l | | | | | |
| 800 | 43.2 | 1 | | | | | |
| 1,000 | 43.2 | | | | | | |
| 1,250 | 46.0 | ĺ | | | | | |
| 1,600 | 48.0 | 1 | | | | | |
| 2,000 | 52.8 | ۱ | | | | | |

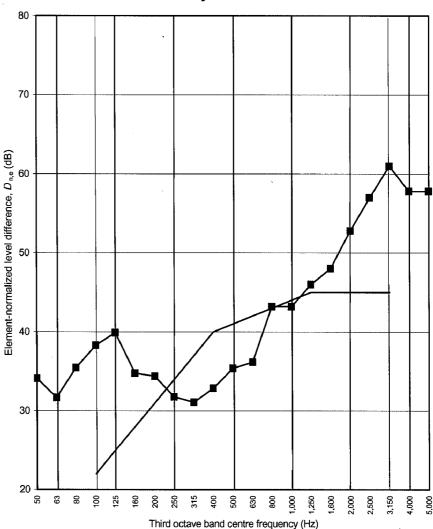

2,500

3,150

4,000

5,000

o Correction = 1.3 dB

Rating according to BS EN ISO 717-1:1997

 $D_{n,e,w}(C;C_{tr}) = 41 (-1;-3) dB$

57.0

61.0

57.8

57.8

= -1 dB= -3 dB C₅₀₋₅₀₀₀ $C_{tr,50-5000}$ = 0 dB= -3 dB $C_{100-5000}$ C_{tr,100-5000} = 0 dB= -3 dB

Evaluation based on laboratory measurement results obtained by an engineering method

C_{tr.50-3150}

Based on the data provided in BS EN 20140-2:1993 it is estimated that the measurement uncertainty should not exceed ±1 dB for the single-number quantity ($D_{n,e,w}$) and should not exceed the values in Table A1 of BS EN 20140-2:1993 for the data in the individual third octaves ($D_{n,e,w}$)

x Adjusted for flanking transmission